


Series Datasheet - KSK-1A46 Reed Switches

## www.andiantech.com

# **KSK-1A46 Reed Switches**

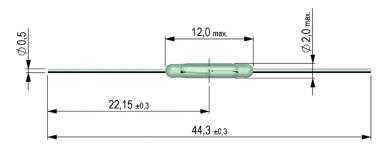

- Features: Miniature, Close Differential, Long Life Expectancy
- Applications: Relay, Valve-Detection, Rotary Detector & Others
- Markets: Test & Measurement, Military, Safety & Others



Contact QTY	Contact Form	Switch Model	Pull-In Excitation (AT-Range)
1	A (SPST-NO)	46	10 – 40

Contact Data		Unit
Rated Power (max.) Any DC combination of V&A not to exceed their individual max.'s	10	W
Switching Voltage (max.) DC or peak AC	200	V
Switching Current (max.) DC or peak AC	0.5	А
Carry Current (max.) DC or peak AC	1.0	А
Contact Resistance (max.) @ 0.5V & 10mA	150	mOhm
Breakdown Voltage (min.) DC or peak AC	225	V
Operating Time (max.) Incl. Bounce; Measured with 40% Overdrive	0.7	ms
Release Time (max.) Measured with no Coil Excitation	0.1	ms
Test Coil	KMS-01	
Insulation Resistance (min.) RH < 45%, 100 V Test Voltage	1,000	GOhm
Capacitance (typ.) @ 10kHz across open Switch	0.2	рF






#### Series Datasheet – KSK-1A46 Reed Switches

#### www.andiantech.com


Dimensions (mm)	ensions (mm)		
Overall Length (max.)	44.3		
Glass Length (max.)	12		
Glass Dia (max.)	2.0		
Lead Dia. (max.)	0.5		

Environmental Data		Unit
Shock Resistance (max.) 1/2 sine wave duration 11ms	50	g
Vibration Resistance (max.)	20	g
Operating Temperature	-40 to 130	°C
Storage Temperature	-55 to 130	°C
Soldering Temperature (max.) 5 sec. max.	260	°C

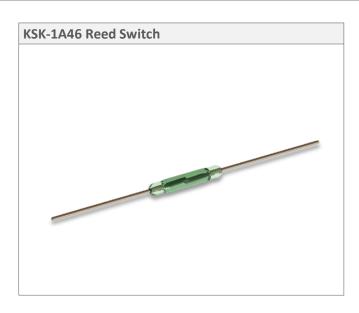

### **Handling & Assembly Instructions**

- Use proper lead clamping or heat sinking techniques to prevent mechanical and/or heat stress to the glass seal during bending, cutting, soldering, and welding
- Mechanical shock as the result of dropping the reed switch typically from a distance of greater than 12" may change it's magnetic sensitivity and/or destroy the switch
- Any form of modification to the switch leads will alter it's magnetic sensitivity
- > Series resistor recommended for >5m cable length

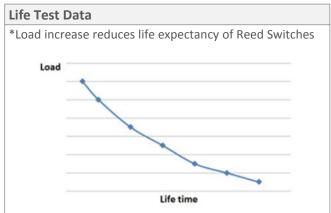

Glossary	lossary			
Form A	NO = Normally Open Contacts SPST = Single Pole Single Throw			
Form B	NC = Normally Closed Contacts SPST = Single Pole Single Throw			
Form C	Changeover SPDT = Single Pole Double Throw			







